



RISHABH

# Data Sheet

---

## QuickFix Module



Measure



Control



Record




Analyze

**RJ05 / RJ01 : 3Ø 5A/1A to 100mA RJ12 QuickFix**

The QuickFix Module allows for the connections of up to three standard current transformer, or standard split-core current transformers (with 1A or 5A secondary), to a 100mA RJ12 input meter.


**Dimensions Details:**

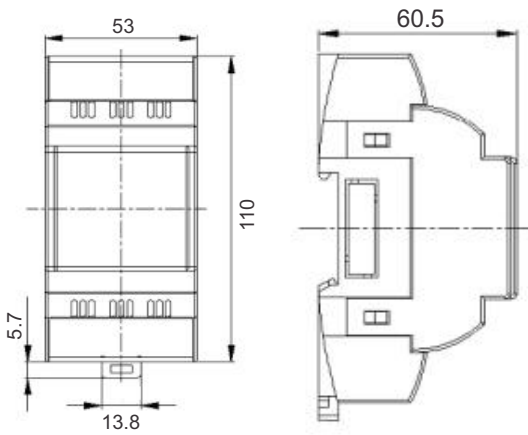

**Technical Specifications:**

|                              |   |
|------------------------------|---|
| <b>Burden</b>                | 0.3VA per phase (1A / 5A)   |
| <b>Accuracy</b>              | 0.5%  |
| <b>Mounting</b>              | 35mm DIN Rail (DIN50022)  |
| <b>Termination</b>           | CT to Adaptor - Rising clamp screw terminals<br>Adaptor to Meter - RJ12 Patch Cable |
| <b>Max input Current</b>     | 120% of nominal current   |
| <b>Output Current</b>        | 100mA   |
| <b>Operating Temperature</b> | -20 °C to 70 °C   |
| <b>Storage Temperature</b>   | -25 °C to 75 °C   |
| <b>Isolation</b>             | 3000Vrms  |

**Connections:**

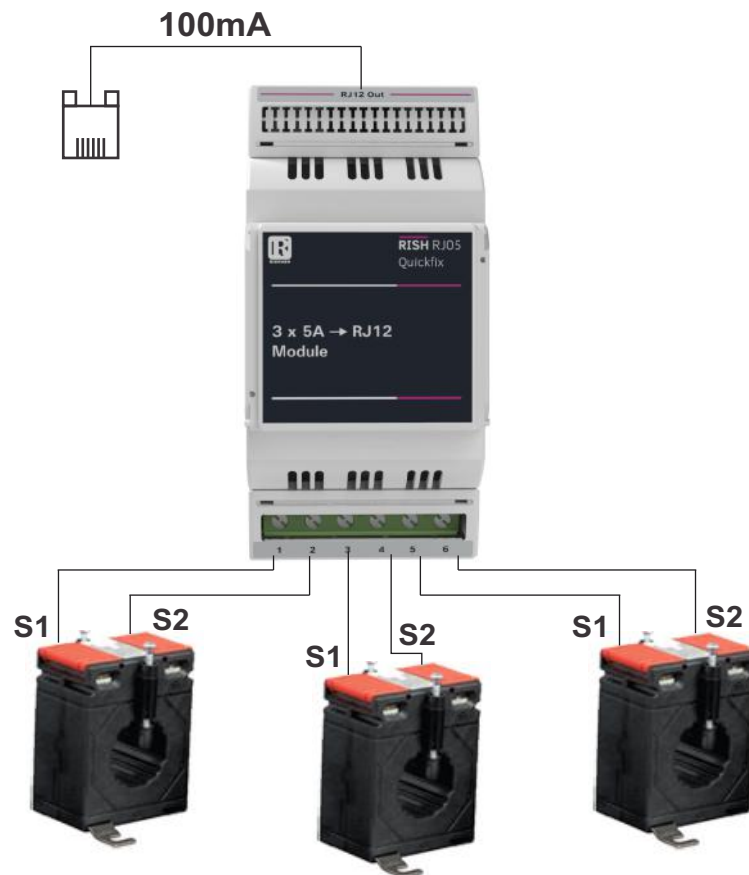

**3 x Standard Current Transformers**



Measure



Control



Record




Analyze

## RJ00 : Single Phase RJ12 to Three Phase RJ12 QuickFix

The QuickFix Module combines the connections of up to three 1Ø RJ12 current transformers, to a single 3Ø RJ12 output for a RJ12 input meter..


### Dimensions

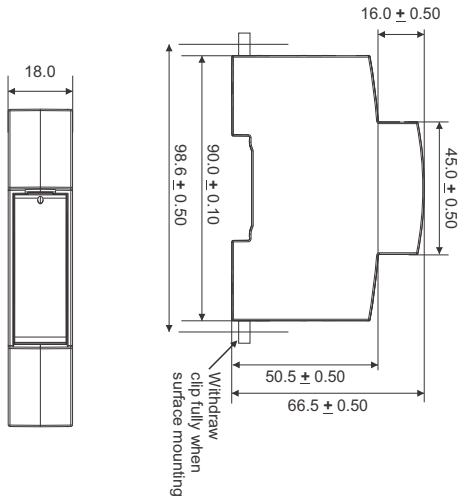

### Technical Specifications:

|                              |   |
|------------------------------|---|
| <b>Mounting</b>              | 35mm DIN Rail (DIN50022)  |
| <b>Termination</b>           | CT to Adaptor - RJ12 Patch Cable<br>Adaptor to Meter - RJ12 Patch Cable |
| <b>Operating Temperature</b> | -20 °C to 70 °C   |
| <b>Storage Temperature</b>   | -25 °C to 75 °C   |

### Connections :

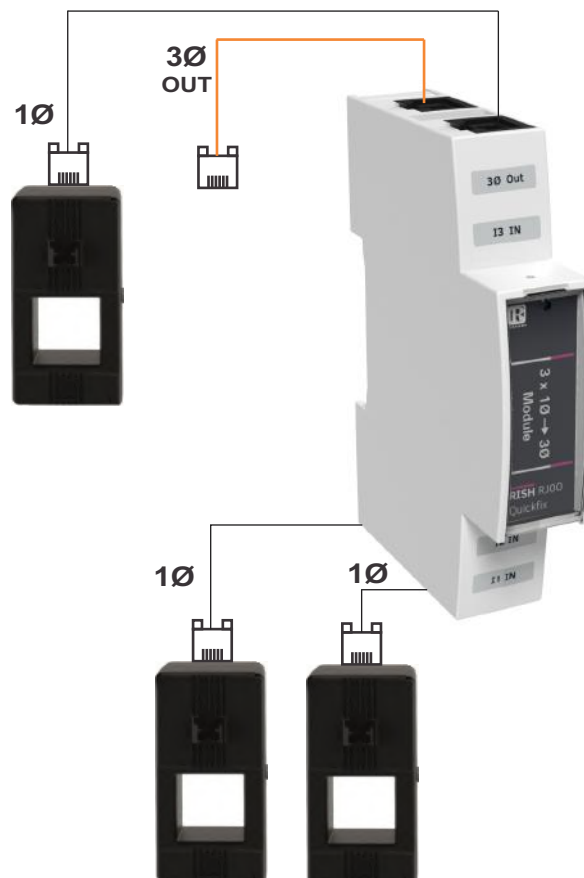

Measure



Control



Record




Analyze

**RC30 : CBCT to RJ12 QuickFix**

The QuickFix Module allows for the connections of up to three CBCT transformer, to a RJ12 input meter.


**Dimensions Details:**

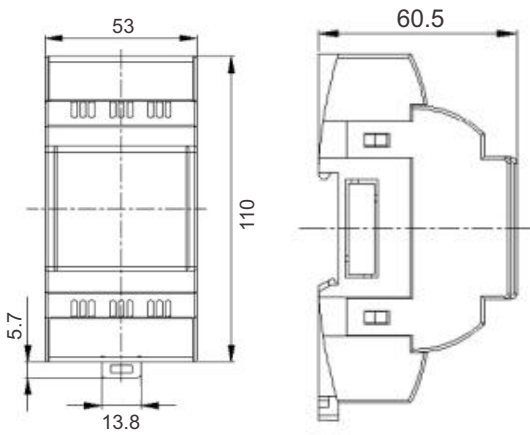

**Technical Specifications:**

|                              |   |
|------------------------------|---|
| <b>Mounting</b>              | 35mm DIN Rail (DIN50022)  |
| <b>Termination</b>           | CT to Adaptor - Rising clamp screw terminals<br>Adaptor to Meter - RJ12 Patch Cable |
| <b>Operating Temperature</b> | -20 °C to 70 °C   |
| <b>Storage Temperature</b>   | -25 °C to 75 °C   |

**Connections:**

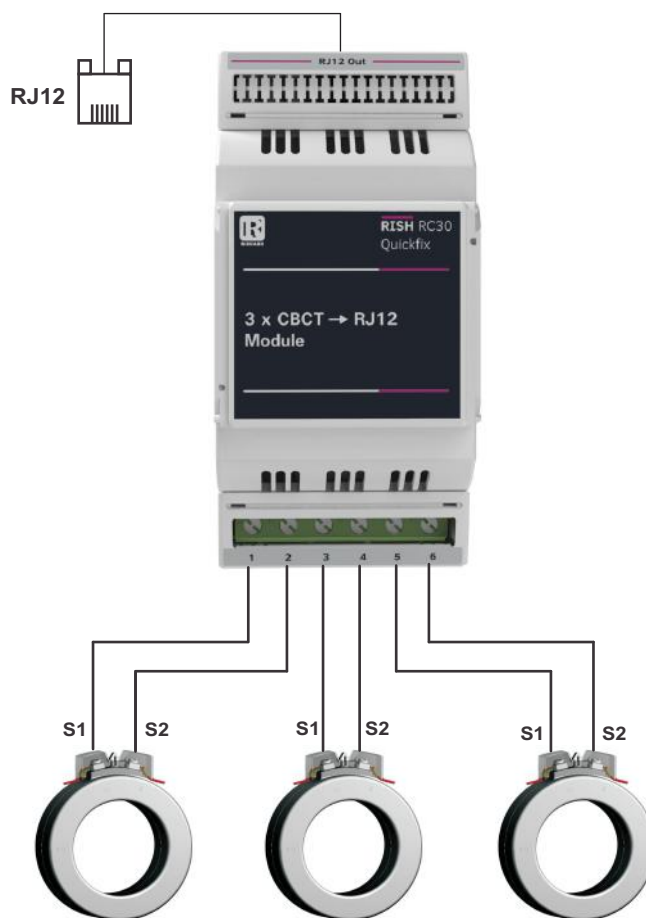

Measure



Control



Record



Analyze

**Order Code:**

Product Code : RJCN-X000000000000

- 1 : RJ00 - 1Ø RJ-12 to 3Ø RJ-12 QuickFix
- 2 : RJ01 - 1A to 100mA RJ-12 QuickFix
- 3 : RJ05 - 5A to 100mA RJ-12 QuickFix
- 4 : RC30 - CBCT to RJ12 QuickFix

**Order Code Examples:**

RJCN-1000000000000 : RJ00 - 1Ø RJ-12 to 3Ø RJ-12 QuickFix



Measure



Control



Record



Analyze



RISHABH



Measure



Control



Record



Analyze

**RISHABH INSTRUMENTS PVT. LTD.**

Domestic (India): +91 253 2202028/99 | [marketing@rishabh.co.in](mailto:marketing@rishabh.co.in)

International: +91 253 2202004/06/08/99 | [global@rishabh.co.in](mailto:global@rishabh.co.in)

[www.rishabh.co.in](http://www.rishabh.co.in)